

Confidential

TECHNICAL SERVICE BULLETIN

NO. 3 A 5



DATE: 3/1/70

BRITISH LEYLAND MOTORS INC.
600 Willow Tree Road • Leonia • New Jersey 07605

SUBJECT:

Accelerator Sticking

MODELS:

Sprite and Midget

Isolated instances have been reported of accelerator linkage sticking at high R.P.M.

This can be caused by the clevis pin which passes through pedal link, part number AHA 6255, catching in the trim on the right side of the driver's footwell.

To correct, either ensure the clevis pin ends are trimmed short, or reverse link AHA 6255.