

Confidential

TECHNICAL SERVICE BULLETIN

3 D 3

NO.



AUSTIN MG
DIVISION

3/1/70

DATE: _____

BRITISH LEYLAND MOTORS INC.
600 Willow Tree Road • Leonia • New Jersey 07605

SUBJECT:

Rear Band Adjustment

MODELS:

MGC With Automatic Transmission

The details of rear band adjustment as outlined in Workshop Manual AKD 7186 are incorrect.

The correct details are as follows:-

- (1) Slacken adjusting screw locknut.
- (2) Tighten the adjusting screw to a torque of 10 lb/ft.
- (3) Release adjusting screw 3/4 of a turn.
- (4) Tighten locknut to 25/30 lb/ft.