

TECHNICAL SERVICE BULLETIN



71 B 12

NO.

November, 1971

SUBJECT:

Fresh Air Heater Controls Outer
Cable Retention.

MODELS:



Austin America

If the outer cable retention clips fail to hold, the following method of repair may be employed:

Remove heater control panel, invert and drill a 3/16" hole as indicated below 5/8" from bottom of flange, center point from side to side.

Install clip, part number 27H1193, and secure to panel with a 8/32 x 1/2" screw and nut.

It may be necessary to slightly increase the bend in the clip if the plastic cracks at the original clip slot.

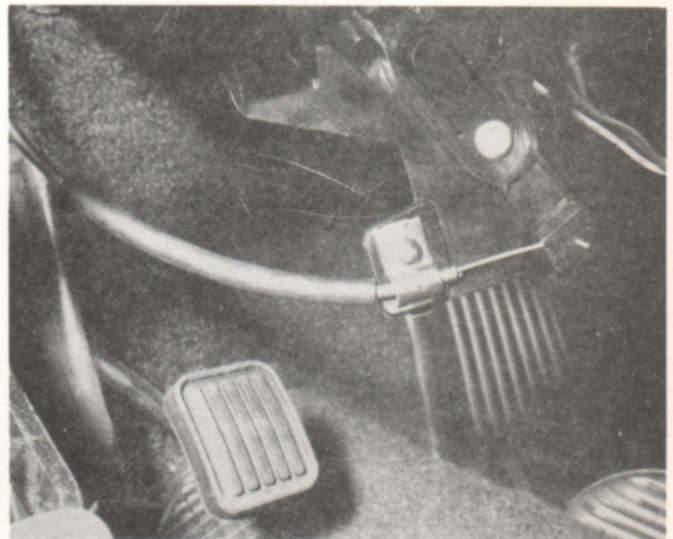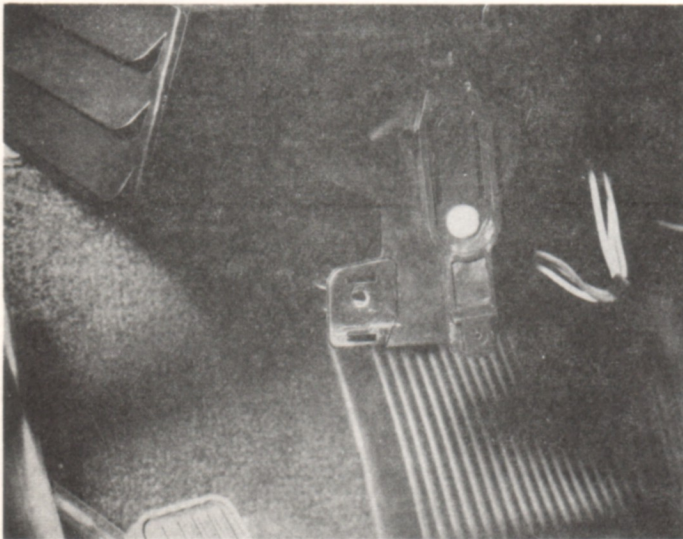

Warranty labour time of .25 hours is allowed.