

TECHNICAL SERVICE BULLETIN

76-D-2

NO.



Austin MG

August, 1976

SUBJECT:

INTERMITTENT BAULKING - 4TH SPEED GEAR

MODELS:

MG MIDGET 1500

A further improvement has been made to the 1st motion shaft dog teeth to prevent intermittent baulking of the 4th speed gear.

Baulking is usually apparent during the initial running of the vehicle, and is generally alleviated with use during the first 1000 miles. Should the problem persist after this mileage has been accrued, the 1st motion shaft only should be replaced.

This condition was corrected on production at the following gearbox number - 17035.

Warranty time for this operation is 10.43 hours.

AM/05/76/26