

Confidential

TECHNICAL SERVICE BULLETIN

NO. 2 A 37



DATE: July 1, 1969

BRITISH LEYLAND MOTORS INC.
600 Willow Tree Road • Leonia • New Jersey 07605

SUBJECT:

Choke Cable

MODELS:

MGC

Cases have been reported of the choke cable on the above model coming in contact with the steering column universal joint, resulting in cable breakage.

When performing routine maintenance on this model, kindly inspect for this condition, and if necessary, modify as follows.

Ensure that the choke outer cable length does not extend into the engine compartment more than 13½ inches. Secure the cable to the rear carburetor overflow pipe with part #AHH 6728 or a similar type clip. Check for satisfactory operation.

Warranty claims are acceptable for .30 hours plus preparation time .25 hours.