

Confidential

TECHNICAL SERVICE BULLETIN

NO. 2 B 27



DATE: 3/17/69

BRITISH LEYLAND MOTORS INC.
600 Willow Tree Road • Leonia • New Jersey 07605

SUBJECT:

Deflector Shield
For Ignition System

MODELS:

Austin America

Complaints of ignition misfiring when driving in heavy rain conditions may be cured by fitting a deflector shield part #HAC 657 behind the center of the grill.

Remove the two center screws securing the grill assembly to the lower panel. Fit shield, replace screws. Center top of shield between hood lock catch and return spring on lever. The coil clamp should be loosened and coil moved if it interferes with the shield. Under no conditions should the shield be bent to provide clearance. Mark and drill platform and shield flange. Secure with the two screws provided.

Note: If ignition H.T. wires have been contaminated by road salt, it is imperative that they are washed with a mild detergent and air dried before fitting the shield.

Warranty claims may be submitted for parts and labour using a labour operation #S001 for 0.3 hrs. (no set up time)