



# TECHNICAL SERVICE BULLETIN

**British Motor Holdings (U.S.A.) Inc.**

734 GRAND AVENUE, RIDGEFIELD, NEW JERSEY 07657

February 29, 1968

TO ALL DISTRIBUTORS AND DEALERS

Re: Intermittent Operation of Windshield Wipers

MG 1275 Sedan

The above problem has been traced to incorrect wiring of the voltage stabilizer mounted behind the instrument panel.

Ensure that the heavy green feed lead and the two feed out leads to the wipers and heater motor are connected to the "B" terminal on the stabilizer. You will note both these leads have lucar plastic covers over the connectors.

