

Confidential
TECHNICAL SERVICE BULLETIN

NO. 2 C 8



DATE: 11/1/69

BRITISH LEYLAND MOTORS INC.
600 Willow Tree Road • Leonia • New Jersey 07605

SUBJECT: WINDOW REGULATORS	MODELS: AUSTIN AMERICA
-----------------------------------	-------------------------------

Overwinding of regulators Part No. CZA 2126 RH and CZA 2127 LH, i.e., disengagement of quadrant from clutch, may be prevented as follows:

1. Remove regulator from door, as per Workshop Manual.
2. Re-engage quadrant teeth in clutch, clamp quadrant in vice and turn last tooth on the side of quadrant nearest the linkage as shown.
3. Replace regulator.

This modification is now incorporated in Production.

