

(SPECIFICATION RANGE: AUF 400 to AUF 499)

# DESCRIPTION AND FAULT DIAGNOSIS

in he kepisong it the sould have been the

Manager to the contract of the Barker Continue to the good option (C) on a gibber the **Sala** sorth this accounts the colores. Barrier (The Strainter Harriston of the Billian (M). When the live of Sales Shift of the control of the the

besieven diet gleink mittelmebt in a jeit ever alter ein er and the contraction of the precision by valve covers (23) (16) tweeds anique they and have (5) and grown a release to The inference (23) after masses to the pumping that been will see the property of the seed of the s (25) washingth say ye before

cate, gener la Vest che une puncient d'Alemeie et de chief. Les friques d'Alemeir d'Alemeire de la commission de la commentation de la commentation de la commentation de

# THE S.U. CARBURETTER COMPANY LIMITED

Proprietors: MORRIS MOTORS LIMITED

oni ci, orinas pit ir šcilskija bil ovi di ANE (1.0) WOOD LANE (1.0) (20)

ERDINGTON

BIRMINGHAM 24

Signal rolling Att William Barrot, also of the

and Wall of reddle freedom All 1888 All Land and mis colored

issurietalyay solomes edibl

aligneeds and cons

SOUTH THE WHILE CONTACT OF Province beautiful to the end of

TELEPHONE: ERDINGTON 7371 (9 lines)

TELEGRAMS: CARBURFLEX, BIRMINGHAM


is useful sill but full bot 100 the bound board one

nockes it Wolfe but Allevon that his marketies were verices bester 

to be be the continue of the continue of such a species standouleting of one and by the cocker spindle (31), and Intern (i) signification of the state of the state

tograma general physical properties a pure engage that the properties and the contract of the Bushy (CO) abdition visualist the Co represents one court o the state of the र देवीं के रेक्से अपने अपने उन्होंने रेन्ट्री राज्य करी की के अपने रेक्सिस के कार्य है।

gelan ale et later brain franzischen Teile bei die eine Krist (voor in 18 de

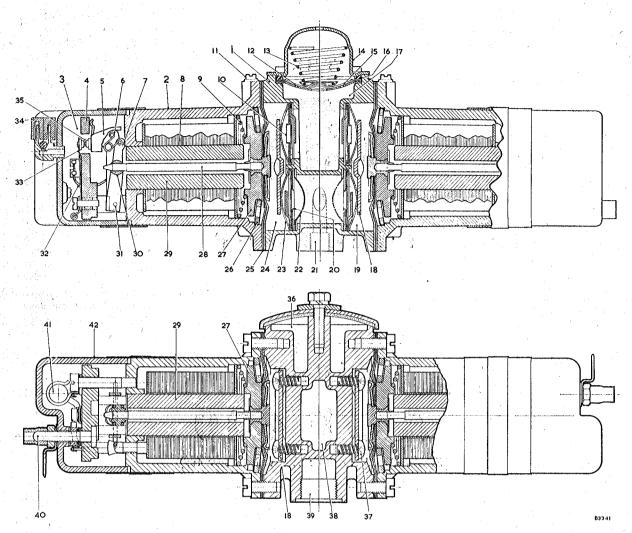

For references see text

. 1 . 18

#### DESCRIPTION

The AUF 400 Type Dual pump is, constructionally, somewhat similar to the AUF 500 Type Double-entry pump as described in Service Sheet AUA 223 A. It differs, however, from the Double-entry pump in that the two pumping chambers with their associated pumping units operate simultaneously, being provided with a common inlet connection.

When a pump is being connected it must be primed by disconnecting the fuel pipe at the carburetter until a flow is obtained.

The pump comprises three main assemblies: the body casting (1), the diaphragm, armature and magnet assembly (2), and the contact-breaker assembly (3). For clarity, these will be described as single units.

#### The body

The body (1) consists of a die casting into which the inlet union (21), shown out of its true position on the diagram, is screwed. The inlet union is in communication with an inlet air bottle (36). A flexible plastic diaphragm and barrier (15) loaded by a spring (13) is contained between the vented cover (14) and the perforated diaphragm plate (12), and sealed by the rubber 'O' ring (16). The assembly, a flow smoothing device, is fitted across the extremity of the delivery chamber (17) which communicates with the outlet union (39).

The inlet valve assembly (20) comprises a plastic disc permanently assembled into a pressed-steel cage which fits into a

recess in the body casting. A domed filter (22) is provided on its entry side.

The outlet valve (10) is an identical assembly but reversed in direction. Both valves are held in position by valve covers (23) retained by a clamp plate (18) and two self-tapping screws (37).

The inlet valve (20) allows passage to the pumping chambers (19 and 24) formed by a shallow depression in the body casting and bounded by the diaphragm (25).

#### The diaphragm, armature, and magnet assembly

The diaphragm (25) is clamped at its outer edge between the coil housing (2) and the body, and attached at its centre to the iron armature (27). The armature spindle (28) passes freely through the magnet core (29) and is screwed into a trunnlon (30) carried by the inner rocker (7). Eleven spherically-edged rollers (26) are fitted between the coil housing and the armature; these centralize the armature in the housing and allow freedom of movement in a longitudinal direction. An atmospheric vent may be drilled in the coil housing.

# The contact breaker assembly

This consists of a bakelite pedestal moulding (4) which carries two rockers, outer (5) and inner (7), both hinged to the moulding at one end by the rocker spindle (31), and interconnected at their top ends by two small toggle springs (6) arranged to give a 'throw-over' action. The inner rocker as mentioned carries a trunnlon into which the armature spindle is

screwed. The outer rocker (5) is fitted with one or two tungsten points (35) which contact other tungsten points carried by the spring blade (33). One end of the coil (8) is connected electrically to the spring blade and the other end is connected to the terminal stud (40). A short length of flexible wire (32) connects the outer rocker to one of the screws securing the pedestal moulding to the coil housing, thus providing an earth return. This must then be thoroughly earthed to the body or chassis of the vehicle via the earthing screw (11). A non-return valve (34) may be fitted to the end-cover moulding (42) to aid the circulation of air through the contact-breaker chamber. A condenser (41) may be fitted in a wire clip to one of the pedestal retaining screws, the tag from it being secured under the contact blade attachment screw.

### **ACTION OF THE PUMP**

When the pump is at rest the outer rocker (5) lies in the position Illustrated and the tungsten points (35) make contact. When switched on, current passes from the terminal stud (40) through the coil, back to the spring blade (33), through the points, and so to earth, thus energizing the coil and attracting the armature (27). The armature, together with the diaphragm assembly, moves towards the coil, against pressure from the armature spring (9), drawing fuel through the inlet valve into the pumping chamber (24). When the armature has travelled well towards the end of its stroke the 'throw over' mechanism operates and the outer rocker moves rapidly backwards, thus separating the contact points and breaking the circuit. The armature and diaphragm will now move away from the coil under the influence of the armature spring, thereby expelling the fuel through the outlet valve at a rate determined by the requirements of the engine. As the armature approaches the end of its stroke, away from the coil, the 'throw over' mechanism again operates, the tungsten points re-make contact, and the cycle of operations is repeated.

#### DIAPHRAGM AND CONTACT-BREAKER SETTINGS

A range of leaflets on Dismantling and Reassembling pumps is available. These should be referred to for operations not listed.

#### Diaphragm

If the diaphragm has been disturbed, it is necessary to reset the position of the armature spindle in the rocker trunnion (30). This is done as follows:

- (1) On modified rocker assemblies set the two stop fingers as described under the heading 'Contact Breaker'.
- (2) Slacken the screw securing the contact blade (33) and swing the blade to one side, so that the points no longer make contact.
- (3) Holding the coil housing (2) in the left hand, screw the diaphragm in generously with the thumb of the right hand, alternately pressing gently and turning until the rocker 'throw-over' ceases.
- (4) Unscrew the diaphragm one-sixth of a turn at a time in the same manner, slowly pressing and turning until the rocker 'throw-over' just operates.
- (5) At this point, continue unscrewing until the nearest securing screw hole is just lined up, and then again four holes (two-thirds of a complete turn). The diaphragm is now correctly set.
- (6) The contact blade, previously swung to one side, should now be replaced in its correct position. The slot for the attachment screw allows a degree of adjustment so that when correctly positioned as the outer rocker operates to make or break the contacts, one pair of points wipes over the the centre-line of the other in a symmetrical manner.

#### Contact breaker for which as he can be

Check that when the outer rocker is pressed on to the coll housing, the contact blade rests on the narrow rib which projects slightly above the main face of the pedestal. If it does not, slacken the contact blade attachment screw, swing the blade clear of the pedestal, and bend it downwards a sufficient amount so that when repositioned it rests against the rib lightly; overtensioning of the blade will restrict the travel of the rocker mechanism.

#### Modified rocker assemblies

(Identified by stop fingers fitted to outer rockers), Check the lift of the blade tip above the top of the pedestal with a feeler gauge, bending the stop finger beneath the pedestal, if necessary, to obtain a lift of  $0.35\pm0.05$  in.  $(.9\pm.13$  mm.).

Check the gap between the rocker finger and coll housing with a feeler gauge bending the stop finger, if necessary, to obtain a gap of  $0.000 \pm 0.000$  in (1.8  $\pm$  13 mm.).

# Earlier-type rocker assemblies

Check the gap between the points indirectly by carefully holding the contact blade against the rib on the pedestal without pressing against the tip of the blade. Then check if a '030 in. (8 mm.) feeler will pass between the fibre rollers and the face of the coil housing. If necessary, the tip of the blade can be set to correct the gap.

#### **FAULT DIAGNOSIS**

#### 1. Suspected fuel feed failure Jahr FORD ALLNING FROM

Disconnect the fuel line at the carburetter and check for flow.

- (a) If normal, examine for obstructed float-chamber needle seating or gummed needle.
- (b) If normal initially, but diminishing rapidly and accompanied by slow pump operation, check for correct tank venting by removing the filler cap. Inadequate venting causes a slow power stroke, with resultant excessive burning of contact points.
- (c) If reduced flow is accompanied by slow operation of the pump, check for any restriction on the inlet side of the pump, such as a clogged filter, which should be removed and cleaned. In the case of reduced flow with rapid operation of the pump, check for an air leak on the suction side, dirt under the valves, or faulty valve sealing washers.
- (d) If no flow, check for:
  - (i) Electrical supply

Disconnect the lead from the terminal and test for an electrical supply.

(II) Faulty contact points

If electrical supply is satisfactory the bakelite cover should be removed to check that the tungsten points are in contact. The lead should then be replaced on the terminal and a short piece of bared wire put across the contacts. If the pump then performs a stroke the fault is due to dirt, corrosion, or maladjustment of the tungsten points.

(iii) Obstructed pipeline between fuel tank and pump

The inlet pipe should be disconnected; if the pump then operates, trouble is due to a restriction in the pipeline between the pump and the tank. This may be cleared by the use of compressed air after removing the fuel tank filler cap. It should be noted, however, that compressed air should not be passed through the pump, as this will cause serious damage to the valves.

(iv) Faulty diaphragm action

If the previous operations fall to locate the trouble, stiffening of the diaphragm fabric or abnormal

friction in the rocker 'throw-over' mechanism is to be suspected. To remedy these faults, the coil housing should be removed and the diaphragm flexed a few times, taking care not to lose any of the 11 rollers under it. Prior to reassembly, it is advisable to apply a little thin oil to the 'throw-over' spring spindles at a point where they pivot in the brass rockers. The diaphragm armature assembly should then be assembled and set in accordance with the instructions given under that heading.

## 2. Noisy pump

Air leaks. If the pump is noisy in operation, an air leak at one or other of the suction lines may be the cause. Such a leak may be checked by disconnecting the fuel pipe from the carburetter and allowing the pump to discharge into a suitable container with the end of the pipe submerged. The emission of continuous bubbles at this point will confirm the existence of an air leak. The fault should be rectified by carrying out the following procedure:

- (a) Check that all connections from the fuel tank to the pump are in good order.
- (b) Check that the inlet union is tight. ej kom vješdi su te čja e 10. slesiosum j

(c) Check that the coil housing securing screws are well and evenly tightened. Air leaks on the suction side cause rapid operation of the pump and are the most frequent cause of premature failure.

# 3. Pump operates without delivering fuel

If the pump operates without delivering fuel the most likely causes are:

- (a) A serious air leak on the suction side, or,
- (b) Foreign matter lodged under one of the valves, particularly under the inlet valve.

To remedy (a) see para. 2 above.

To remove any foreign matter lodged under the valves these should be removed for cleaning.

#### **GUARANTEE**

The terms of the guarantee on this pump are precisely the same as those on the car to which it is fitted.

The technical information contained in this Service Sheet supersedes any previous instructions published or authorised on this subject by the Company.

# AUTHORIZED DISTRIBUTOR:

The second second second of the second of the second secon

salan are an are in record of the time.

ng kaluantika grimatika ng kaluantika ng kaluanti Bijin jalifika kala sa kaluantika ng kaluantika sacaras of his collings in the fire

The second of th

องรัฐบริษัท สิทธิ์ รวมการ์ การเลืองได้ เป็นเพลาะ กา

्रिया पूर्व अपूर्वाहर विकास है। विकास में दिना को इसके करने हैं। प्राथमिक प्राथमिक विकास से किस को स्थाप की किस कर की की सम्बोधिक की सुरक्षित की हैं।

Get of group has decided in the control again

Takka (1966) (196) (196

Marking Market Arginal again sa Salah, Jangaya A kali kangan kanar Mikir di Loha Jajana Pojes benjak di l The a first of a second of the second of