



TECHNICAL SERVICE BULLETIN

British Motor Holdings (U.S.A.) Inc.

734 GRAND AVENUE, RIDGEFIELD, NEW JERSEY 07657

March 1, 1968

TO ALL DISTRIBUTORS AND DEALERS


Re: Body Drainage Apertures

Mini, 1100

To reduce the possibility of sill corrosion, periodic examination of the drain holes illustrated should be made to ensure they are clear and have not been deformed in any way.

Incorrect location of the jack (i.e., failure to use the jacking points provided) may damage the apertures. Also careless application of a sealer to the underbody floor may result in restricted drainage, if not complete blockage of the apertures. All concerned should be reminded that adequate masking is necessary before commencing under-sealing operations.

MINI

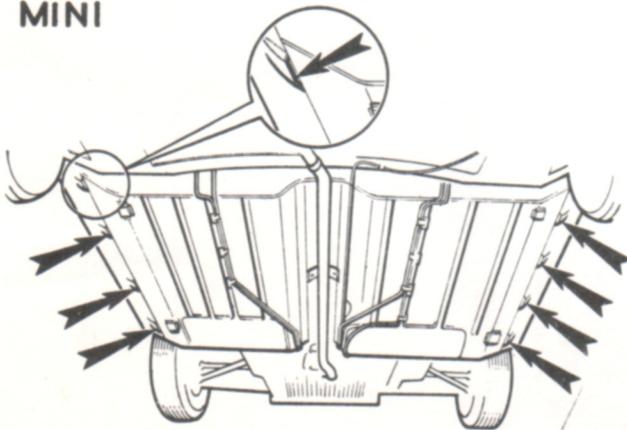

1100

