



# TECHNICAL SERVICE BULLETIN

**British Motor Holdings (U.S.A.) Inc.**

734 GRAND AVENUE, RIDGEFIELD, NEW JERSEY 07657

April 1, 1968

TO ALL DISTRIBUTORS AND DEALERS

Re: Radio Fitment To Console

1968 Sprites and Midgets

Initially some of the above models may be supplied without the radio blanking plate aperture. It will, therefore, be necessary to follow these additional instructions.

With the console unit removed, centralize the radio face plate as shown in Figure 1.

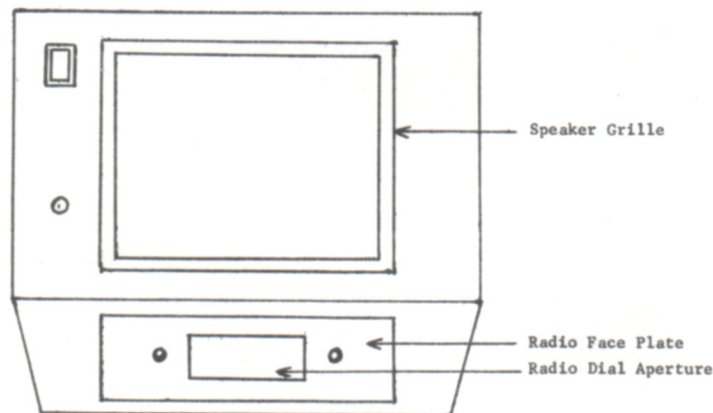


Fig. 1

Holding the face plate firmly against the console, remove the console cloth from the radio dial aperture with a razor blade or other suitable tool. Mark both spindle holes.

- (1) Drill both spindle holes to 9/16" diameter.
- (2) At each corner of the dial aperture, drill a 5/16" diameter hole.
- (3) Trim out excess metal with a saber saw.

This installation require bezel, Part Number AHH 5255.