



SERVICE

# TECHNICAL SERVICE BULLETIN

The British Motor Corporation / Hambro Inc.

734 GRAND AVENUE, RIDGEFIELD, NEW JERSEY 07657

April 28, 1967

TO ALL DISTRIBUTORS AND DEALERS

Re: Starter Jingle

MGB  
MGB/GT


A new starter motor modified to eliminate 'jingle' was introduced at the following Engine Nos:

18 GBUH 42716

18 GBRUH 43101

The modification can be incorporated into earlier starters by fitting a 'wavy' circlip obtainable through your local Lucas Depot, Part Number 54240551, in place of the flat one holding the barrel locking nut into the pinion and barrel assembly.

This circlip is fitted as illustrated at 'A', with the two ends pointing towards the barrel and with neither end visible in the slots in the barrel.

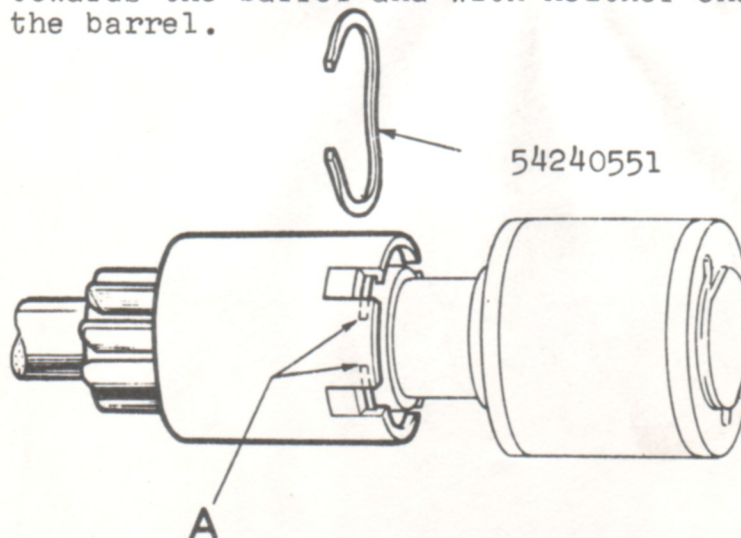

Warranty Claims will be accepted for time allowance to R & R starter plus  $\frac{1}{2}$  hour to install circlip.