TECHNICAL SERVICE BULLETIN	NO. 2 F 32
AUSTIN MC DIVISION	DATE:8/20/69
BRITISH LEYLAND MOTORS INC. 600 Willow Tree Road • Leonia • New Jersey 07605	
MODELS:	

MD T M	HEIGHTS	
I'R I M	HELGHTS	

SUBJECT:

ALL MODELS FITTED WITH HYDROLASTIC SUSPENSION


A

Dimension

The following data applies to cars where the suspension has 'settled' normally, no action should be taken to alter trim heights unless there is evidence of fluid loss or mechanical failure.

Checking must be carried out with full oil and water content plus 4 gallons (18.30 litres, 5 3/4 US gallons) of petrol. Any equipment other than standard should be removed.

The vehicle should be rocked transversely, with effort applied at the top of the 'B' post before measuring trim heights.

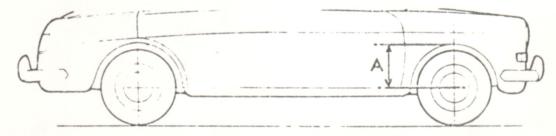

Model

13 in. <u>+</u>3/8 in. (330.2 mm) 14 in. <u>+</u>3/8 in. (355.6 mm) 13 9/16 in. <u>+</u>3/8 in. (344.5mm)

All Cooper Models Austin, Morris 2 door manual All other 1100/1300 versions including Austin America

Rear trim heights may be disregarded unless there is an obvious discrepancy in the attitude of the car.